

Maura J. Rossman, M.D., Health Officer

Bureau of Environmental Health
8930 Stanford Boulevard, Columbia, MD 21045
Main: 410-313-2640 | Fax: 410-313-2648
TDD 410-313-2323 | Toll Free 1-866-313-6300
www.hchealth.org
Facebook: www.facebook.com/hocohealth

RECEIPT DATE: 5/27/2026 **ONSITE SEWAGE DISPOSAL SYSTEM**

P 5-91056

APPROVAL DATE: 6/23/26 **PERMIT: REPAIR**

A

PROPERTY ADDRESS: 685 Watersville Road Mt Airy MD 21771

SUBDIVISION: _____ LOT: _____ TAX ID: 04-361261

CONTRACTOR: Legacy Septic & Excavation LLC EMAIL: info@legacyseptic.com

CONTRACTOR ADDRESS: 2914 Hanover Pike Manchester MD 21102 PHONE: 410-840-8766

PROPERTY OWNER: David J Furman & Stephanie Furman EMAIL: dfurman@gmail.com

OWNER ADDRESS: 685 Watersville Road Mt Airy MD 21771 PHONE: 410-497-7771

SEPTIC TANK SIZE (GALLONS): Existing TANK MANUFACTURER: Existing

PUMP MODEL: N/A PUMP SIZE N/A PUMP TANK CAPACITY: N/A

DISTRIBUTION SYSTEM: ☒ GRAVITY ☐ PRESSURE DOSED BEDROOMS: 4 APPLICATION RATE: 0.6

TRENCHES:	LINEAR FEET REQUIRED: <u>276'</u>	INLET DEPTH: <u>2.5'</u>
	TRENCH WIDTH: <u>3'</u>	MAXIMUM BOTTOM DEPTH: <u>8'</u>
	MINIMUM SPACE BETWEEN TRENCHES: <u>10'</u>	EFFECTIVE AREA BEGINNING DEPTH: <u>7'</u>
LOCATION:	PER APPROVED SITE PLAN. SEWAGE DISPOSAL AREA AND TANK LOCATIONS MUST BE STAKED BY LICENSED SURVEYOR PRIOR TO PRE-CONSTRUCTION INSPECTION.	
NOTES:	Install new d-box Install 6 x 46' trenches per plan	

ISSUED BY: K. Wolf ISSUE DATE: 6/3/2026 EXPIRATION DATE: 6/3/2027

NOTE: CONTRACTOR MUST SCHEDULE A PRE-CONSTRUCTION INSPECTION PRIOR TO BEGINNING ANY INSTALLATION

NOTE: CONTRACTOR MUST SCHEDULE AN INSPECTION AND GAIN APPROVAL OF ALL COMPONENTS PRIOR TO COVERING

NOTE: STONE MUST BE APPROVED BY HEALTH DEPARTMENT AND GRAVEL TICKET MUST BE AVAILABLE FOR REVIEW.

NOTE: WATERTIGHT TANKS REQUIRED

NOTE: ALL PARTS OF SEPTIC SYSTEM SHALL BE AT LEAST 100 FEET DOWNGRAIENT FROM ANY WATER WELL

NOTE: MANHOLE RISERS REQUIRED ON ALL SEPTIC TANKS AND PUMP CHAMBERS

NOTE: AN ELECTRICAL PERMIT IS REQUIRED FOR INSTALLATION OF ANY ELECTRICAL COMPONENTS OF THE SYSTEM

☒ ELECTRICAL PERMIT ISSUED E N/A


NOTE: MDE RECOMMENDS SEPTIC TANKS, BAT, AND OTHER PRETREATMENT UNITS BE PUMPED AT A FREQUENCY ADEQUATE TO ENSURE THAT SOLIDS ARE NOT DISCHARGED TO THE DISPOSAL AREA

NEITHER THE HOWARD COUNTY COUNCIL NOR THE HEALTH DEPARTMENT IS RESPONSIBLE FOR THE SUCCESSFUL OPERATION OF ANY SYSTEM.

PERMITTEE RESPONSIBLE FOR OBTAINING FINAL APPROVAL ON THIS PERMIT.

CALL 410-313-1771 TO SCHEDULE INSPECTIONS.

NOT TO SCALE

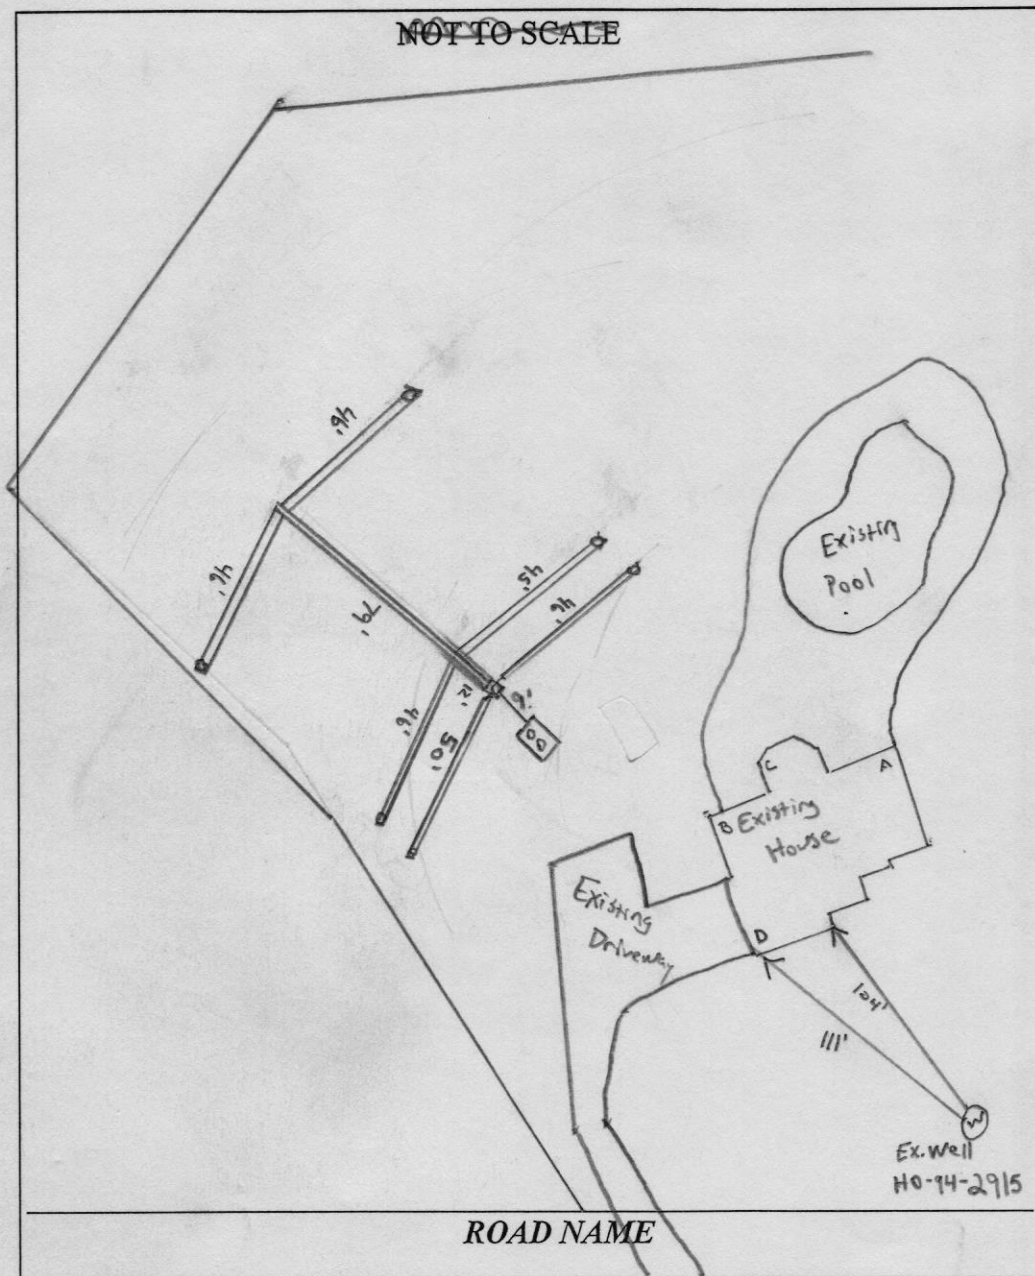

TRENCH/DRAINFIELD DATA

WIDTH	INLET	BOTTOM
3'	2.5'	8'

NUMBER OF TRENCHES 6

TOTAL LENGTH 279 ft

ABSORPTION AREA 837F+² + Sideval

DISTRIBUTION BOX LEVEL Yes

DISTRIBUTION BOX BAFFLE Yes

DISTRIBUTION BOX PORT Yes

SEPTIC TANK DATA

SEPTIC TANK 1 LEVEL Existing

MANUFACTURER Unknown

CAPACITY 1,250 GAL

SEAM LOC UnKnown

TANK LID DEPTH 1 footBAFFLES 6" Front / 4" BackBAFFLE FILTER N/A

MANHOLE LOC East of tank

6" PORT LOC Back of tank

WATERTIGHT TEST No

SLOTTED Viknoda

DATE ON LID Installed in 2001

PUMP/SEPTIC TANK LEVEL N/A

MANUFACTURER

CAPACITY	GAL
100	100
200	200
300	300
400	400
500	500
600	600
700	700
800	800
900	900
1000	1000
1100	1100
1200	1200
1300	1300
1400	1400
1500	1500
1600	1600
1700	1700
1800	1800
1900	1900
2000	2000
2100	2100
2200	2200
2300	2300
2400	2400
2500	2500
2600	2600
2700	2700
2800	2800
2900	2900
3000	3000
3100	3100
3200	3200
3300	3300
3400	3400
3500	3500
3600	3600
3700	3700
3800	3800
3900	3900
4000	4000
4100	4100
4200	4200
4300	4300
4400	4400
4500	4500
4600	4600
4700	4700
4800	4800
4900	4900
5000	5000
5100	5100
5200	5200
5300	5300
5400	5400
5500	5500
5600	5600
5700	5700
5800	5800
5900	5900
6000	6000
6100	6100
6200	6200
6300	6300
6400	6400
6500	6500
6600	6600
6700	6700
6800	6800
6900	6900
7000	7000
7100	7100
7200	7200
7300	7300
7400	7400
7500	7500
7600	7600
7700	7700
7800	7800
7900	7900
8000	8000
8100	8100
8200	8200
8300	8300
8400	8400
8500	8500
8600	8600
8700	8700
8800	8800
8900	8900
9000	9000
9100	9100
9200	9200
9300	9300
9400	9400
9500	9500
9600	9600
9700	9700
9800	9800
9900	9900
10000	10000

SEAM LOC 1

TANK LID DEPTH _____

BAFFLES _____

BAFFLE FILTER _____

MANHOLE LOC _____

6" PORT LOC _____

WATERTIGHT TEST _____

SLOTTED _____

DATE ON LID _____

CONTROL PANEL DATA

CONTROL PANEL HEIGHT (MIN 30") N/A

INSPECTION DATE N/A

INSPECTION: PASS/FAIL (CIRCLE ONE)

SEPTIC CONTRACTOR ONSITE INSTALLING SYTEM: Leroy Bucini
SEPTIC CONTRACTOR ONSITE LICENSED WITH THE STATE OF MD: YES/NO

PRE-CONSTRUCTION NOTES:

INSTALLATION NOTES:

6/16/26 On site day after install. Contractor claims they called in for inspection, but inspection not recorded in logbook. Only 1 trench has 46' length per plan. Could not verify inlets of upper 4 trenches. Bottom trench inlets are 3'. Middle trenches covered up, could not verify inlets. Stuck measuring tape down observation ports on middle two trenches and only goes to 7' depth. New d-box installed, needs a baffle. New observation port installed on back of septic tank. Will be out tomorrow to verify findings with Legacy Septic. * Corrective actions needed for trench lengths, geotextile fabric, trench pipe on sides of trench, no baffle in d-box. Stone depths, pipe inlet depths. * (MC)

FINAL INSPECTOR M. Burns . DATE OF APPROVAL 6/22/26

* See file inquiry notes page for additional notes *



MEMORANDUM

Date: June 19th, 2026

Re: Septic System Installation at 685 W. Watersville road Mt Airy, MD 21771

To Whom It May Concern:

This letter serves as confirmation that the onsite sewage disposal system installed at the above-referenced property was completed in accordance with the approved septic permit.

The installation included septic absorption trenches constructed with the following specifications:

- Trench bottoms installed at a depth of **8 feet** below grade.
- Trenches constructed to a width of **3 feet**.
- Distribution piping installed with an **inlet depth of 2.5 feet**.
- A **5.5-foot depth of approved stone** was installed beneath and around the piping, with a minimum of **6 inches of stone placed above the pipe**.

The system was installed in accordance with the approved design. Furthermore, the installation was completed under the supervision of and by an individual licensed through the **Maryland State Board of On-Site Wastewater Professionals**.

Should you require any additional information regarding this installation, please do not hesitate to contact our office.

Sincerely,

A handwritten signature in black ink, appearing to be "L. Buccini & G. Schooley", written over a horizontal line.

Leroy Buccini & George Schooley
Licensed On-Site Wastewater Professionals
Maryland State Board of On-Site Wastewater Professionals
License No. 2211 & 122

A handwritten signature in black ink, appearing to be "L. Buccini & G. Schooley", written over a horizontal line.

685 W. Watersville Rd - Septic install

From Burns, Matthew <mburns@howardcountymd.gov>

Date Thu 6/18/2026 4:20 PM

To dfurman@gmail.com <dfurman@gmail.com>; sdmusick@gmail.com <sdmusick@gmail.com>

Cc Wolf, Kevin <KWolf@howardcountymd.gov>; Page, Shepsura <spage@howardcountymd.gov>; Rappaport, Ryan <RRappaport@howardcountymd.gov>

Good afternoon,

My name is Matt Burns and I am an inspector with the Howard County Health Dept. I am writing to inform you about the installation of the septic system completed by Legacy Septic.

Per our county code, the Health Dept. conducts inspections of septic system installations during their construction. Legacy Septic completed their install on Monday, 6/15 and did not make the health dept. aware they were installing the system until Tuesday, 6/16. Due to this, we did not see the installation of your system. I went out to verify their work yesterday, 6/17 and I had some concerns about the work that was completed:

1. The trench pipe installed on four of the six trenches seem to be installed close to the side of the trench. Pipe should be installed in the center of a trench for proper drainage.
2. The geotextile fabric laid overtop of the pipe and stone was bunched in spots. This allows dirt to seep through below the septic pipe.
3. Not adequate stone placed at the beginning and ends of some of the trenches. This could cause the pipe to bow and break.
4. Could not verify trench bottom depth and trench pipe inlet depths. Contractor says he installed per the septic permit plan. Digging up trenches to verify at this point will probably do more damage than good due to the potential for the dirt to mix with the septic stone.

I had the contractor remediate points #2 and #3. He added additional stone, and spot placed geotextile fabric in the trenches where coverage was lacking.

Final approval of this system is still pending, I am reaching out to the contractor to get a letter from them confirming that they have installed the trenches and trench pipe inlets per the septic permit.

Feel free to reach out with any questions/concerns.

Kind regards,

Matt Burns, EH Specialist
Well & Septic Program | Howard County Health Department
8930 Stanford Blvd., Columbia, MD 21045
410-313-2643 (Office) | 410-313-2648 (Fax)
www.hchealth.org
mburns@howardcountymd.gov



6/16/20 685 Waterville Rd



Geotextile fabric not spread completely over stone in trench. (MP)



Pipe not bedded and is oriented on side of trench (MP)

6/17/26 685 Watersville Rd * See notes on back * (M)





- Stone now placed under and 6" above previously exposed trench pipe.
- Geotextile fabric added over top of spots where previously laid fabric was not completely covering trench.
- Baffle installed in d-box, speed breakers adjusted (MB)



Middle trench covered



Upper trench does not have adequate stone, pipe is on side of trench



Total scope of work performed



Upper trench



Middle trench covered



Bottom two trenches



Middle trench covered



Bottom trench pipe on side of trench

685 Watersville Rd - 6/16/26



HOME LAND

ENVIRONMENTAL

homelandhealthyhomes.com | 443.995.5385 | info@homelandhealthyhomes.com

Headquarters- 1220 East Joppa Road, Towson MD 21286

Date: April 20, 2026 Name of Evaluator: Tyler Young Time: 8:00 AM Property Address: 685 W Watersville Road Mount Airy, MD 21771 Recent Weather Conditions: Normal		Ordered By: Christine Basham Buyers: Mark Pennsy Homeowner Interview: The homeowner interview was sent but not received prior to the evaluation.		Occupied: ☒ Yes ☐ No Length of Time Vacant: N/A # of People Living in Home: Unknown # of People moving in: Unknown Property Age: 2001 System Age: 2001 Last Date of Cleaning: Unknown Recomm'd Pumping Freq: 2-3 Years	
Liquid level in tank is: ☒ Above Normal ☐ Normal ☐ Below Normal				Bottom Solids Depth: 24 Inches	
Depth of tank: 12 Inches		Type of Tank Access: Cleanout		Depth of tank access: At Grade	
Maintenance appears: ☐ Good ☐ Fair ☒ Poor		# of Bedrooms: 4		Depth to Distribution Box: Unknown	
Effluent Filter present: ☐ Yes ☒ No		Previous high liquid level: ☒ Yes ☐ No		Distance to well: ~190 Feet	
Records Search: Records were requested and received from Howard County prior to the evaluation.					
Were there any impermeable surfaces above the septic system (i.e. driveway)? ☐ Yes ☒ No					
Type of Tank		Tank Composition and Size		Type of Absorption System	
☒ Septic Tank (1 Tank)		☐ Metal ☒ Concrete ☐ Plastic		☒ Leaching Field ☐ Raised Mound	
☐ Aeration System		Tank Size: 1,250 gallons		☐ Drywell (Number of:) ☐ Cesspool	
☐ Other:				☐ Unknown: _____	
System Component		Condition		Comments	
Septic Tank		☒ Acceptable ☐ Unacceptable ☐ Needs Further Evaluation		The septic tank is 1,250 gallons in capacity and composed of concrete. The tank is 12 inches below grade; a cleanout serves as access at grade. It is strongly recommended a manhole riser access at grade be installed to facilitate future cleanings and maintenance. The front and back baffles are in place and composed of PVC. The solids level in the tank is 24 inches, indicating poor maintenance. It is recommended that the tank be cleaned, then every 2-3 years thereafter.	
Absorption System		☐ Acceptable ☒ Unacceptable ☐ Needs Further Evaluation		Per county records, the absorption system is composed of a distribution box and 3 drainfields. Each drainfield was probed and found to be holding heavy moisture with signs of biomat. During the hydraulic load test, a backup occurred in the septic tank. During the camera inspection, evidence of previous backups was observed in the front line, and a backup was observed in the back line and absorption system. This indicates the drainfields have reached the end of their life. The absorption system will need to be replaced by a licensed septic contractor once permits are issued by the local health department.	

HOME LAND

ENVIRONMENTAL

homelandhealthyhomes.com | 443.995.5385 | info@homelandhealthyhomes.com

Headquarters- 1220 East Joppa Road, Towson MD 21286



Picture 1:

Showing evidence of previous backups on the underside of the front line cleanout cap.



Picture 2:


Showing the PVC back baffle of the septic tank. A backup has occurred in the septic tank during the hydraulic load test.

HOME LAND

ENVIRONMENTAL

homelandhealthyhomes.com | 443.995.5385 | info@homelandhealthyhomes.com

Headquarters- 1220 East Joppa Road, Towson MD 21286

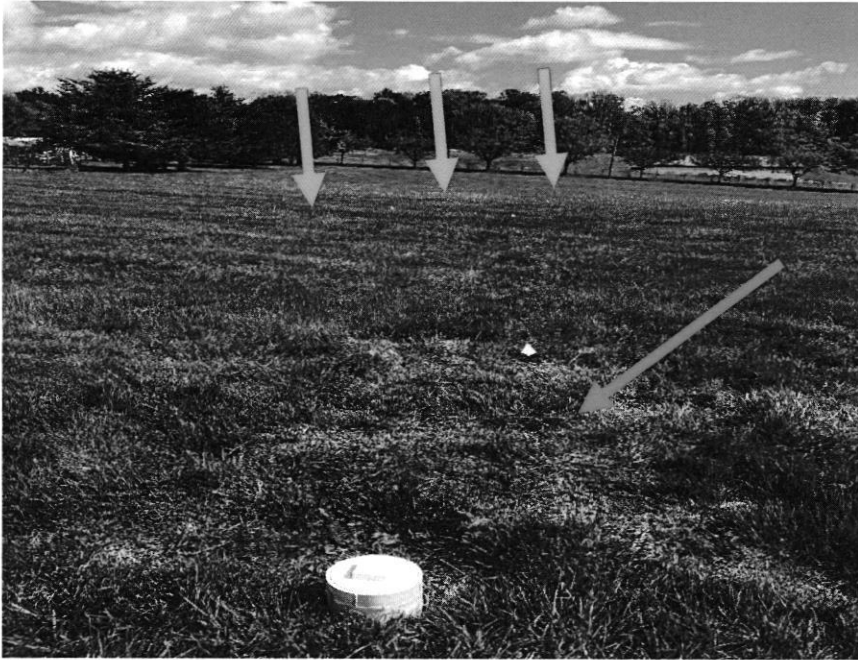

Picture 3:

Showing the locations of the septic tank (red arrow) and located drainfields (yellow arrows).



Picture 4:

Showing heavy moisture with signs of biomat from probing the located drainfields.

HOME LAND

ENVIRONMENTAL

homelandhealthyhomes.com | 443.995.5385 | info@homelandhealthyhomes.com

Headquarters- 1220 East Joppa Road, Towson MD 21286

Sketch of System

**PLEASE REFER TO SEPARATE COUNTY RECORDS
(WS_WestWatersville_685_SepticPermit-2001.pdf, Page 2 of 3) FOR DETAILED
SKETCH.**


DISCLAIMERS

- This is a subjective and visual inspection only, the conclusions of which are based on the observed condition of the system components that could reasonably be accessed, and information known about the system at the time this report was completed. There may be unknown historical problems or unseen conditions which may compromise the conclusions stated in this report.
- Suggestions or recommendations for repairs or remediation may result in the need for further repair or remediation once the system components are fully excavated.
- A 'Satisfactory' evaluation does not mean the system will meet the local approving authority's criteria for determining compliance with state code: COMAR 26.04.02.02 D(4).
- The evaluation of the Sewage Disposal System as reported is based on the conditions observed on the day of the inspection.
- This report is neither a WARRANTY nor does it GUARANTEE continued acceptable functionality or performance of the Sewage Disposal Systems operations.
- If the house has been unoccupied the findings in this report may not be accurate, as limited or no use of the system may conceal or mask problems that may be revealed under typical sewage loading.
- If the general ground condition is excessively wet at the time of inspection, the findings in this report may not be accurate, as ground moisture may cover or hide septic effluent that may be on or near the ground surface.
- If the house is vacant or the conditions excessively wet during inspection, it is recommended that the system be reevaluated at a later date and/or alternate techniques be used to address those potential issues.
- Payment and/or use of this evaluation signify understanding and acceptances of the above clauses, as well as any noted faults with the system.

Representative's Signature:



Date: 4/20/2026

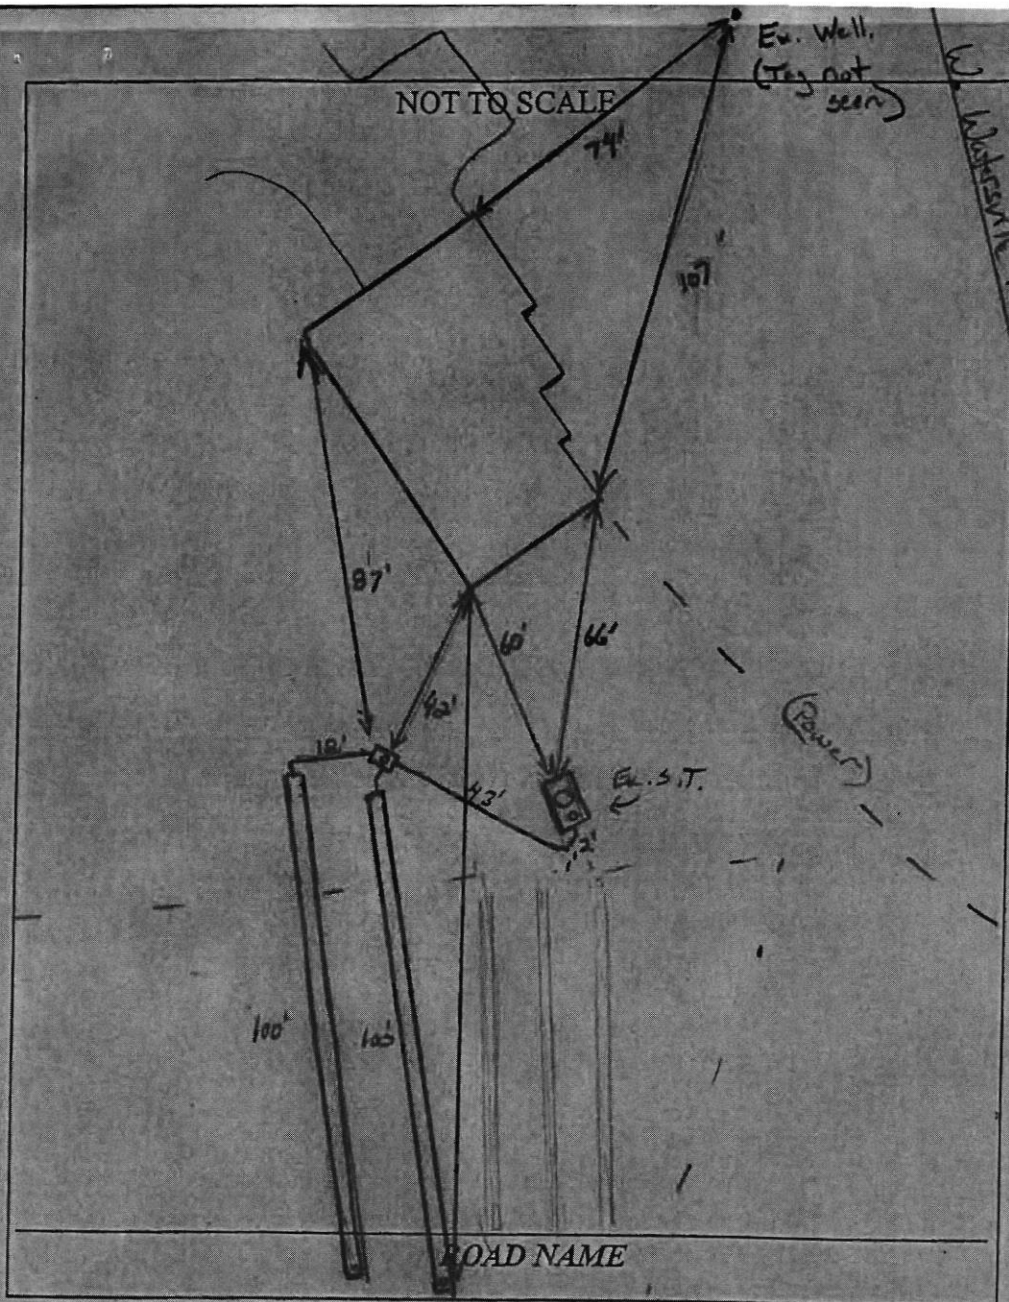

TRENCH/DRAINFIELD DATA		
WIDTH	INLET	BOTTOM
2'	4'	10'
NUMBER OF TRENCHES		2
TOTAL LENGTH		
ABSORPTION AREA		
DISTRIBUTION BOX LEVEL		Level
DISTRIBUTION BOX BAFFLE		Yes
DISTRIBUTION BOX PORT		Yes

SEPTIC TANK DATA	
SEPTIC TANK 1 LEVEL	Yes
MANUFACTURER	?
CAPACITY	1250 GAL
SEAM LOC	mid
TANK LID DEPTH	2'
BAFFLES	Yes
BAFFLE FILTER	Yes (Polylok PL-9)
MANHOLE LOC	
6" PORT LOC	Rear
WATERTIGHT TEST	OK
SLOTTED	no
DATE ON LID	-

PUMP/SEPTIC TANK LEVEL	
MANUFACTURER	
CAPACITY	GAL
SEAM LOC	
TANK LID DEPTH	
BAFFLES	
BAFFLE FILTER	
MANHOLE LOC	
6" PORT LOC	
WATERTIGHT TEST	
SLOTTED	
DATE ON LID	

PRE-CONSTRUCTION:

8/28/13 Trenches laid out. Contractor to follow existing trenches. Install 20x100' trench just below initial existing system. New D-box. Entrenched manhole riser on tank. Outlet baffle. Filter may be installed (call for inspection) (see)

INSTALLATION:

9/18/13 Top trench being dug, stoned. New plumbing tie in made to D-box and top trench. Trench contractor OK to cover. Work completed and to leave D-box network open and lower trench @ ends (see)


9/19/13 System complete. Contractor installed outlet baffle filter pl-68. OK for residential use. OK to cover all work (see)

FINAL INSPECTOR

K. Walf

DATE OF APPROVAL

9/19/13

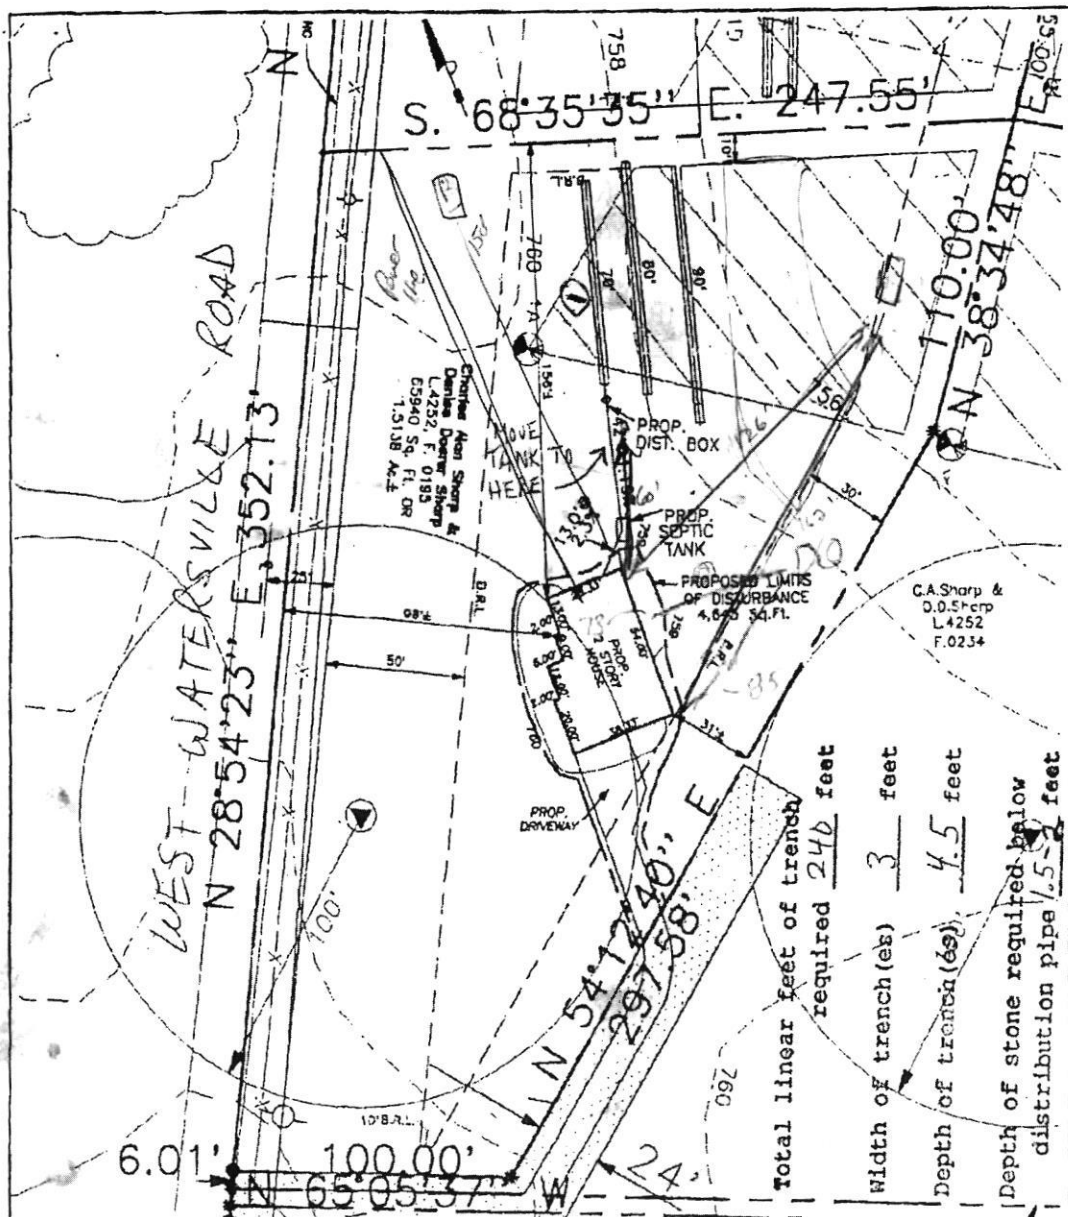

Proposed House:
 FF Elev.=762.3
 Bsmt =753.8
 Inv. Out=757.3(Hung Sewer)

Proposed Septic Tank:
 Ex. Elev.=759.0
 Inv. In =757.0
 Inv. Out=756.7

Proposed Distribution Box:
 Ex. Elev.=759.0
 Inv. In =756.2
 Inv. Out=755.9

Proposed Trenches:
 1070' / 1080' / 1090' =240L.F.
 3'Wide, 2'Stone, Max. Depth=4.5

NOTE: Actual length and number of trenches for sewerage are to be determined at the time of septic system permit issuance.

Approved Septic System Plan
 Howard County Health Department

OK FOR TRENCH ① INVERT
 AT 3' BELOW GRADE
 OTHER TRENCHES AT 2.5' B.G.
 PLOT PLAN
 lands conveyed to

Charles Alan Sharp &
 Denise Doerer Sharp

Liber 4252 Folio 020B
 #681 West Watersville Road

Fourth Election District
 Howard County, Maryland
 Scale: 1"=50' November, 2000

Mark R. Allen
 Signature Date 1/16/01

I CERTIFY THIS PLAN TO BE CORRECT; IT IS THE RESULT OF AN ACTUAL FIELD SURVEY, BASED ON DATA FOUND AMONG THE LAND RECORDS OF HOWARD COUNTY, MARYLAND, AS REFERENCED HEREON.

REFERENCE	JOB NO.
L. 4252 F. 020B	89-2185-0010-001



VANMAR ASSOCIATES, INC.
 Engineers Surveyors Planners
 310 South Main Street P.O. box 328
 Mount Airy, Maryland 21771
 (301) 829 2890 (301) 831 5015 (410) 549 7751

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702338**

Cust#: LEGSEP 6/10/2026
LEGACY SEPTIC & EXCAVATION LLC 7:45:22AM
Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121
Trk#: 448A - K.D. CAPLE

* Manual P. T.

Zone#: I-08 - FINKSBURG -I-08 Gross: 69360
P.O.#: * Tare: 23340
Proj#: Net: 46020
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 23.01

	Loads	Tons
Job/Daily:	2	45.71
Job/Total:	13	291.47

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liabile for Any Damage to Person or Property.

*Material Safety Data Information Available Upon Request.***Have A Great Day. Please Drive Safely!****S.W. BARRICK - FINKSBURG TERMINAL**

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702338**

Cust#: LEGSEP 6/10/2026
LEGACY SEPTIC & EXCAVATION LLC 7:45:22AM
Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121
Trk#: 448A - K.D. CAPLE

* Manual P. T.

Zone#: I-08 - FINKSBURG -I-08 Gross: 69360
P.O.#: * Tare: 23340
Proj#: Net: 46020
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 23.01

	Loads	Tons
Job/Daily:	2	45.71
Job/Total:	13	291.47

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liabile for Any Damage to Person or Property.

*Material Safety Data Information Available Upon Request.***Have A Great Day. Please Drive Safely!**

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702277**

Cust#: LEGSEP 6/10/2026
LEGACY SEPTIC & EXCAVATION LLC 6:06:11AM
Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121
Trk#: 448A - K.D. CAPLE

* Manual P. T.
Zone#: I-08 - FINKSBURG -I-08 Gross: 68740
P.O.#: * Tare: 23340
Proj#: Net: 45400
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 22.70

	Loads	Tons
Job/Daily:	1	22.70
Job/Total:	12	268.46

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

*Material Safety Data Information Available Upon Request.***Have A Great Day. Please Drive Safely!****S.W. BARRICK - FINKSBURG TERMINAL**

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702277**

Cust#: LEGSEP 6/10/2026
LEGACY SEPTIC & EXCAVATION LLC 6:06:11AM
Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121
Trk#: 448A - K.D. CAPLE

* Manual P. T.
Zone#: I-08 - FINKSBURG -I-08 Gross: 68740
P.O.#: * Tare: 23340
Proj#: Net: 45400
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 22.70

	Loads	Tons
Job/Daily:	1	22.70
Job/Total:	12	268.46

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

*Material Safety Data Information Available Upon Request.***Have A Great Day. Please Drive Safely!**

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400

2700 Emory Rd.

Finksburg, MD 21048

FT

TKT: 702276

Cust#: LEGSEP

LEGACY SEPTIC & EXCAVATION LLC

6/9/2026

3:25:54PM

Job#: WESWAT 685 WEST WATERSVILLE RD

MT AIRY

GEORGE 301-370-4121

Trk#: 403U - BOPST TRUCKING - CB1095

* P. T.

Zone#: I-08 - FINKSBURG -I-08

Gross: 68700

P.O.#:

* Tare: 25980

Proj#:

Net: 42720

Mat'l#: 22-#2 WASHED STONE (AASHTO#3)

TONS: 21.36

	Loads	Tons
Job/Daily:	11	245.76
Job/Total:	11	245.76

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy LindemannWe exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

Material Safety Data Information Available Upon Request.

Have A Great Day. Please Drive Safely!

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400

2700 Emory Rd.

Finksburg, MD 21048

FT

TKT: 702276

Cust#: LEGSEP

LEGACY SEPTIC & EXCAVATION LLC

6/9/2026

3:25:54PM

Job#: WESWAT 685 WEST WATERSVILLE RD

MT AIRY

GEORGE 301-370-4121

Trk#: 403U - BOPST TRUCKING - CB1095

* P. T.

Zone#: I-08 - FINKSBURG -I-08

Gross: 68700

P.O.#:

* Tare: 25980

Proj#:

Net: 42720

Mat'l#: 22-#2 WASHED STONE (AASHTO#3)

TONS: 21.36

	Loads	Tons
Job/Daily:	11	245.76
Job/Total:	11	245.76

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy LindemannWe exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

Material Safety Data Information Available Upon Request.

Have A Great Day. Please Drive Safely!

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702273**

Cust#: LEGSEP 6/9/2026
LEGACY SEPTIC & EXCAVATION LLC 3:09:55PM
Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121

Trk#: 448A - K.D. CAPLE

* Manual P. T.

Zone#: I-08 - FINKSBURG -I-08 Gross: 68980
P.O.#: * Tare: 23340
Proj#: Net: 45640
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 22.82

	Loads	Tons
Job/Daily:	10	224.40
Job/Total:	10	224.40

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

*Material Safety Data Information Available Upon Request.***Have A Great Day. Please Drive Safely!****S.W. BARRICK - FINKSBURG TERMINAL**

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702273**

Cust#: LEGSEP 6/9/2026
LEGACY SEPTIC & EXCAVATION LLC 3:09:55PM
Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121

Trk#: 448A - K.D. CAPLE

* Manual P. T.

Zone#: I-08 - FINKSBURG -I-08 Gross: 68980
P.O.#: * Tare: 23340
Proj#: Net: 45640
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 22.82

	Loads	Tons
Job/Daily:	10	224.40
Job/Total:	10	224.40

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

*Material Safety Data Information Available Upon Request.***Have A Great Day. Please Drive Safely!**

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400

2700 Emory Rd.

Finksburg, MD 21048

FT

TKT: 702251

Cust#: LEGSEP

LEGACY SEPTIC & EXCAVATION LLC

6/9/2026

1:54:06PM

Job#: WESWAT 685 WEST WATERSVILLE RD

MT AIRY

GEORGE 301-370-4121

Trk#: 403U - BOPST TRUCKING - CB1095

* P. T.

Zone#: I-08 - FINKSBURG -I-08

Gross: 68760

P.O.#:

* Tare: 25980

Proj#:

Net: 42780

Mat'l#: 22-#2 WASHED STONE (AASHTO#3)

TONS: 21.39

	Loads	Tons
Job/Daily:	9	201.58
Job/Total:	9	201.58

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy LindemannWe exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

Material Safety Data Information Available Upon Request.

Have A Great Day. Please Drive Safely!

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400

2700 Emory Rd.

Finksburg, MD 21048

FT

TKT: 702251

Cust#: LEGSEP

LEGACY SEPTIC & EXCAVATION LLC

6/9/2026

1:54:06PM

Job#: WESWAT 685 WEST WATERSVILLE RD

MT AIRY

GEORGE 301-370-4121

Trk#: 403U - BOPST TRUCKING - CB1095

* P. T.

Zone#: I-08 - FINKSBURG -I-08

Gross: 68760

P.O.#:

* Tare: 25980

Proj#:

Net: 42780

Mat'l#: 22-#2 WASHED STONE (AASHTO#3)

TONS: 21.39

	Loads	Tons
Job/Daily:	9	201.58
Job/Total:	9	201.58

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy LindemannWe exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

Material Safety Data Information Available Upon Request.

Have A Great Day. Please Drive Safely!

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702243**

Cust#: LEGSEP 6/9/2026
LEGACY SEPTIC & EXCAVATION LLC 1:36:57PM

Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121

Trk#: 448A - K.D. CAPLE

* Manual P. T.

Zone#: I-08 - FINKSBURG -I-08 Gross: 68920
P.O.#: * Tare: 23340
Proj#: Net: 45580
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 22.79

	Loads	Tons
Job/Daily:	8	180.19
Job/Total:	8	180.19

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

Material Safety Data Information Available Upon Request.

Have A Great Day. Please Drive Safely!

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702243**

Cust#: LEGSEP 6/9/2026
LEGACY SEPTIC & EXCAVATION LLC 1:36:57PM

Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121

Trk#: 448A - K.D. CAPLE

* Manual P. T.

Zone#: I-08 - FINKSBURG -I-08 Gross: 68920
P.O.#: * Tare: 23340
Proj#: Net: 45580
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 22.79

	Loads	Tons
Job/Daily:	8	180.19
Job/Total:	8	180.19

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

Material Safety Data Information Available Upon Request.

Have A Great Day. Please Drive Safely!

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400

2700 Emory Rd.

Finksburg, MD 21048

FT

TKT: 702213

Cust#: LEGSEP 6/9/2026
LEGACY SEPTIC & EXCAVATION LLC 12:11:05PM

Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121

Trk#: 403U - BOPST TRUCKING - CB1095

* P. T.

Zone#: I-08 - FINKSBURG -I-08 Gross: 69400
P.O.#: * Tare: 25980
Proj#: Net: 43420
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 21.71

	Loads	Tons
Job/Daily:	7	157.40
Job/Total:	7	157.40

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

*Material Safety Data Information Available Upon Request.***Have A Great Day. Please Drive Safely!****S.W. BARRICK - FINKSBURG TERMINAL**

PH: (410) 833-4400

2700 Emory Rd.

Finksburg, MD 21048

FT

TKT: 702213

Cust#: LEGSEP 6/9/2026
LEGACY SEPTIC & EXCAVATION LLC 12:11:05PM

Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121

Trk#: 403U - BOPST TRUCKING - CB1095

* P. T.

Zone#: I-08 - FINKSBURG -I-08 Gross: 69400
P.O.#: * Tare: 25980
Proj#: Net: 43420
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 21.71

	Loads	Tons
Job/Daily:	7	157.40
Job/Total:	7	157.40

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

*Material Safety Data Information Available Upon Request.***Have A Great Day. Please Drive Safely!**

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT

TKT: 702209

Cust#: LEGSEP 6/9/2026
LEGACY SEPTIC & EXCAVATION LLC 11:57:38AM

Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121

Trk#: 448A - K.D. CAPLE

Zone#: I-08 - FINKSBURG -I-08 Gross: 69840
P.O.#: * Tare: 23340
Proj#: Net: 46500
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 23.25

* Manual P. T.

	Loads	Tons
Job/Daily:	6	135.69
Job/Total:	6	135.69

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

*Material Safety Data Information Available Upon Request.***Have A Great Day. Please Drive Safely!****S.W. BARRICK - FINKSBURG TERMINAL**

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT

TKT: 702209

Cust#: LEGSEP 6/9/2026
LEGACY SEPTIC & EXCAVATION LLC 11:57:38AM

Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121

Trk#: 448A - K.D. CAPLE

Zone#: I-08 - FINKSBURG -I-08 Gross: 69840
P.O.#: * Tare: 23340
Proj#: Net: 46500
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 23.25

* Manual P. T.

	Loads	Tons
Job/Daily:	6	135.69
Job/Total:	6	135.69

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

*Material Safety Data Information Available Upon Request.***Have A Great Day. Please Drive Safely!**

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702182**

Cust#: LEGSEP 6/9/2026
LEGACY SEPTIC & EXCAVATION LLC 10:30:09AM
Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121

Trk#: 403U - BOPST TRUCKING - CB1095

Zone#: I-08 - FINKSBURG -I-08 Gross: 69440
P.O.#: * Tare: 25980
Proj#: Net: 43460
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 21.73

	Loads	Tons
Job/Daily:	5	112.44
Job/Total:	5	112.44

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

*Material Safety Data Information Available Upon Request.***Have A Great Day. Please Drive Safely!****S.W. BARRICK - FINKSBURG TERMINAL**

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702182**

Cust#: LEGSEP 6/9/2026
LEGACY SEPTIC & EXCAVATION LLC 10:30:09AM
Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121

Trk#: 403U - BOPST TRUCKING - CB1095

Zone#: I-08 - FINKSBURG -I-08 Gross: 69440
P.O.#: * Tare: 25980
Proj#: Net: 43460
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 21.73

	Loads	Tons
Job/Daily:	5	112.44
Job/Total:	5	112.44

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

*Material Safety Data Information Available Upon Request.***Have A Great Day. Please Drive Safely!**

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702179**

Cust#: LEGSEP 6/9/2026
LEGACY SEPTIC & EXCAVATION LLC 10:21:42AM
Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121

Trk#: 448A - K.D. CAPLE

* Manual Weight

Zone#: I-08 - FINKSBURG -I-08 Gross: 68800
P.O.#: * Tare: 23340
Proj#: * Net: 45460
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) * TONS: 22.73

	Loads	Tons
Job/Daily:	4	90.71
Job/Total:	4	90.71

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

*Material Safety Data Information Available Upon Request.***Have A Great Day. Please Drive Safely!****S.W. BARRICK - FINKSBURG TERMINAL**

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702179**

Cust#: LEGSEP 6/9/2026
LEGACY SEPTIC & EXCAVATION LLC 10:21:42AM
Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121

Trk#: 448A - K.D. CAPLE

* Manual Weight

Zone#: I-08 - FINKSBURG -I-08 Gross: 68800
P.O.#: * Tare: 23340
Proj#: * Net: 45460
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) * TONS: 22.73

	Loads	Tons
Job/Daily:	4	90.71
Job/Total:	4	90.71

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

*Material Safety Data Information Available Upon Request.***Have A Great Day. Please Drive Safely!**

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400

2700 Emory Rd.

Finksburg, MD 21048

FT

TKT: 702138

Cust#: LEGSEP

LEGACY SEPTIC & EXCAVATION LLC

Job#: WESWAT 685 WEST WATERSVILLE RD

MT AIRY

GEORGE 301-370-4121

Trk#: 403U - BOPST TRUCKING - CB1095

Zone#: I-08 - FINKSBURG -I-08

P.O.#:

Proj#:

Mat'l#: 22-#2 WASHED STONE (AASHTO#3)

* P. T.

Gross: 69240

* Tare: 25980

Net: 43260

TONS: 21.63

	Loads	Tons
Job/Daily:	2	44.84
Job/Total:	2	44.84

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy LindemannWe exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

Material Safety Data Information Available Upon Request.

Have A Great Day. Please Drive Safely!

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400

2700 Emory Rd.

Finksburg, MD 21048

FT

TKT: 702138

Cust#: LEGSEP

LEGACY SEPTIC & EXCAVATION LLC

Job#: WESWAT 685 WEST WATERSVILLE RD

MT AIRY

GEORGE 301-370-4121

Trk#: 403U - BOPST TRUCKING - CB1095

Zone#: I-08 - FINKSBURG -I-08

P.O.#:

Proj#:

Mat'l#: 22-#2 WASHED STONE (AASHTO#3)

* P. T.

Gross: 69240

* Tare: 25980

Net: 43260

TONS: 21.63

	Loads	Tons
Job/Daily:	2	44.84
Job/Total:	2	44.84

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy LindemannWe exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

Material Safety Data Information Available Upon Request.

Have A Great Day. Please Drive Safely!

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702156****Cust#:** LEGSEP

LEGACY SEPTIC & EXCAVATION LLC

6/9/2026

8:50:16AM

Job#: WESWAT 685 WEST WATERSVILLE RD

MT AIRY

GEORGE 301-370-4121

Trk#: 448A - K.D. CAPLE

* Manual P. T.

Zone#: I-08 - FINKSBURG -I-08**Gross:** 69620**P.O.#:*** **Tare:** 23340**Proj#:****Net:** 46280**Mat'l#:** 22-#2 WASHED STONE (AASHTO#3)**TONS:** 23.14

	Loads	Tons
Job/Daily:	3	67.98
Job/Total:	3	67.98

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

Material Safety Data Information Available Upon Request.

Have A Great Day. Please Drive Safely!

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702156****Cust#:** LEGSEP

LEGACY SEPTIC & EXCAVATION LLC

6/9/2026

8:50:16AM

Job#: WESWAT 685 WEST WATERSVILLE RD

MT AIRY

GEORGE 301-370-4121

Trk#: 448A - K.D. CAPLE

* Manual P. T.

Zone#: I-08 - FINKSBURG -I-08**Gross:** 69620**P.O.#:*** **Tare:** 23340**Proj#:****Net:** 46280**Mat'l#:** 22-#2 WASHED STONE (AASHTO#3)**TONS:** 23.14

	Loads	Tons
Job/Daily:	3	67.98
Job/Total:	3	67.98

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

Material Safety Data Information Available Upon Request.

Have A Great Day. Please Drive Safely!

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702128**

Cust#: LEGSEP
LEGACY SEPTIC & EXCAVATION LLC
Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121

6/9/2026
7:11:30AM

Trk#: 448A - K.D. CAPLE

* Manual P. T.

Zone#: I-08 - FINKSBURG -I-08 Gross: 69760
P.O.#: * Tare: 23340
Proj#: Net: 46420
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 23.21

	Loads	Tons
Job/Daily:	1	23.21
Job/Total:	1	23.21

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

Material Safety Data Information Available Upon Request.

Have A Great Day. Please Drive Safely!

S.W. BARRICK - FINKSBURG TERMINAL

PH: (410) 833-4400
2700 Emory Rd.
Finksburg, MD 21048

FT**TKT: 702128**

Cust#: LEGSEP
LEGACY SEPTIC & EXCAVATION LLC
Job#: WESWAT 685 WEST WATERSVILLE RD
MT AIRY
GEORGE 301-370-4121

6/9/2026
7:11:30AM

Trk#: 448A - K.D. CAPLE

* Manual P. T.

Zone#: I-08 - FINKSBURG -I-08 Gross: 69760
P.O.#: * Tare: 23340
Proj#: Net: 46420
Mat'l#: 22-#2 WASHED STONE (AASHTO#3) TONS: 23.21

	Loads	Tons
Job/Daily:	1	23.21
Job/Total:	1	23.21

Directions:

BACK-IN FROM ROAD LOOK FOR SPRAY PAINT SIGN

WEIGHMASTER: Cassidy Lindemann

We exercise No Control Over Delivery of Our Products & We Won't
be Held Liable for Any Damage to Person or Property.

Material Safety Data Information Available Upon Request.

Have A Great Day. Please Drive Safely!

L

Homeowners: David & Stephanie Furman

Address: 685 West Watersville, Mt Airy, MD 21771

Phone: 410-497-7771

Email: dfurman@gmail.com


Installer & plan preparer: George Schooley, Legacy Septic & Excavation LLC

License: ~~UTL09175~~ 00122

Address: 2914 Hanover Pike Manchester MD 21102

Phone: 410-840-8766

Email: info@legacyseptic.com

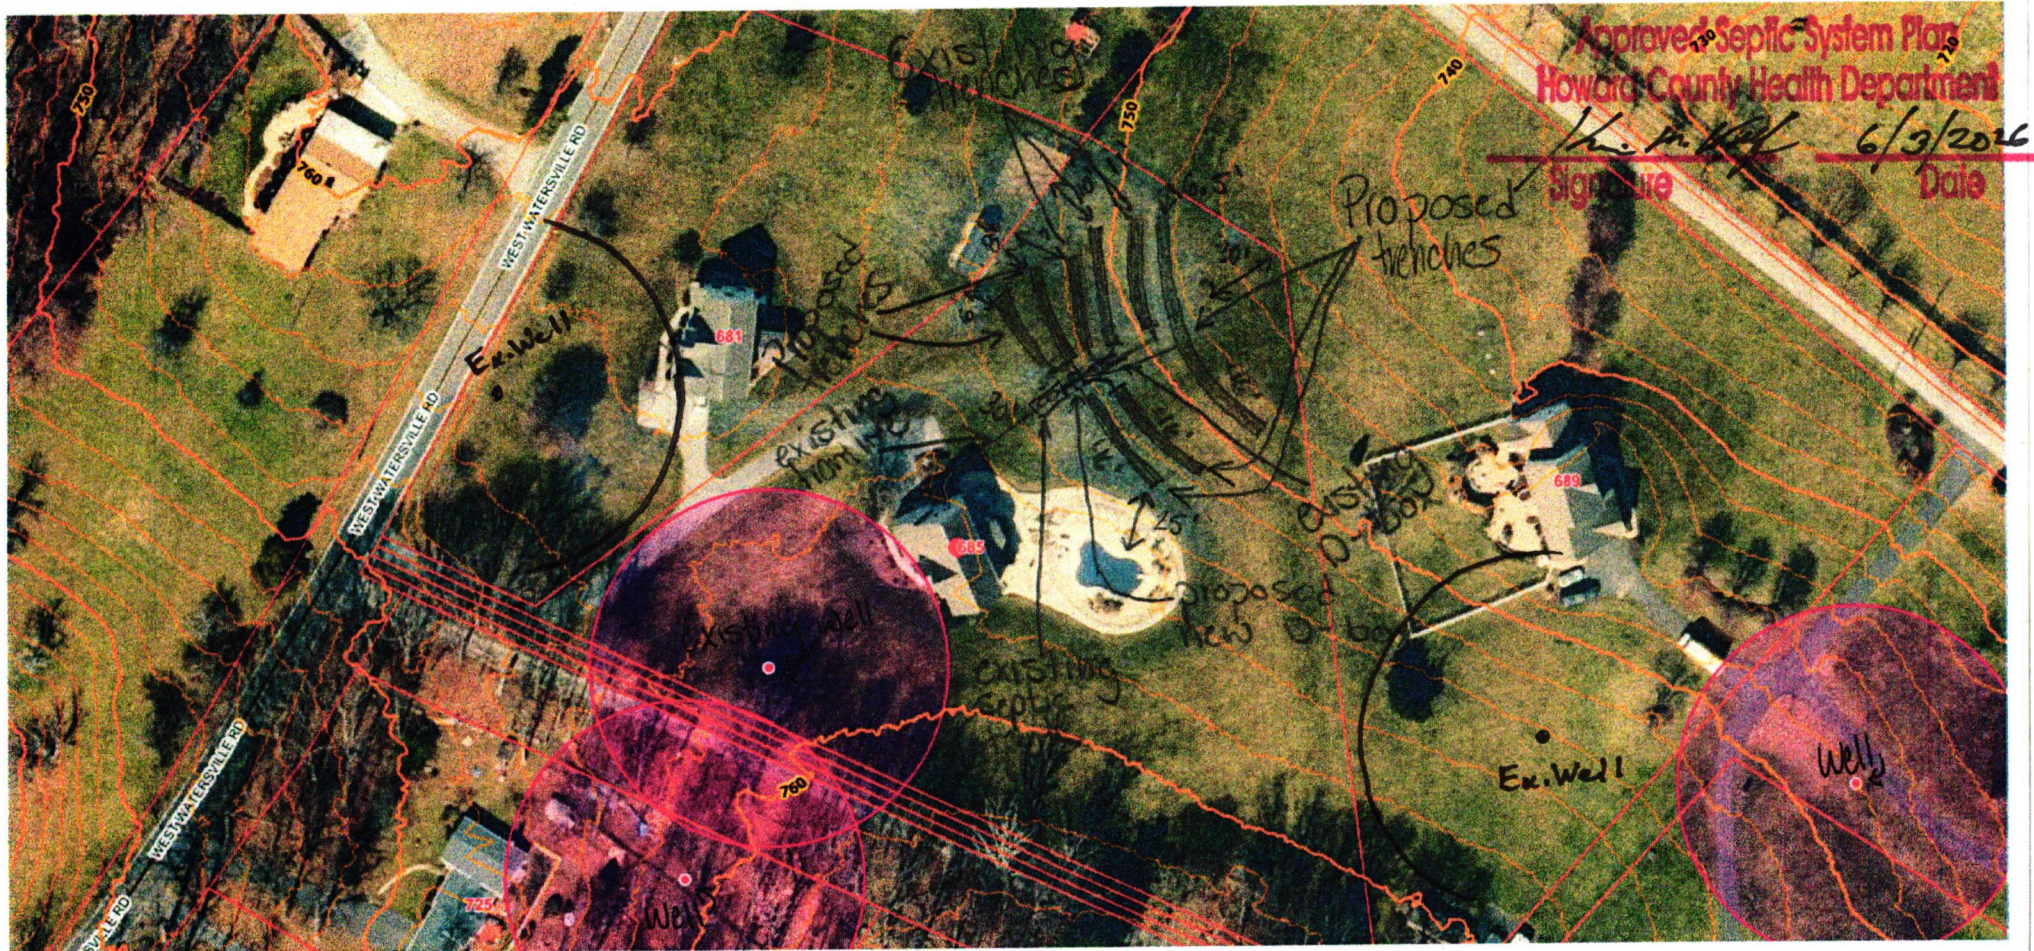

Proposed work: Install (6) trenches (46ft length, 3ft wide, 8ft deep, 5.5 ft of stone under pipe), install distribution box with access at grade, install associated piping from distribution box to trenches.

Existing bedrooms: 4

Existing tank size: 1250 Gallons with risers at grade

Existing trenches: (3) trenches, 240 ft total length, 3ft wide, 4.5ft deep, 2ft stone below pipe

685 W. Watersville Road
Mt. Airy MD 21771



Proposed work:

- (6) 46ft trenches
- 3ft wide, 8ft deep
- 5.5ft Stone under pipe